



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123



CASE SUMMARY

PSU 02 CASE NO. 026G TYPE OF ACCIDENT Utility Vehicle Rollover

A. DESCRIPTION OF THE ACCIDENT SEQUENCE AND ACCIDENT PECULIARITIES

(Provide a summary of the accident sequence as well as any particular event of the accident that is noteworthy. Injury mechanism and vehicle crashworthiness is the focus, not driver culpability. Do not include any personal identifiers.)

Vehicle #1 traveling in passing lane of 4 lane divided roadway, brakes to avoid vehicle in lane, driving off left side of roadway rotating counterclockwise and rolling over.

B. VEHICLE PROFILE(S)

Vehicle No.	Class of Vehicle	Year/Make/Model	Most Severe Damage Based on Vehicle Inspection		Component Failure
			Damage Plane	Severity Description	
1	compact utility	90 Toyota 4-Runner	top	moderate	none

DO NOT SANITIZE THIS FORM

C. PERSON PROFILE(S)

Vehicle No.	Person Role	Seat Position	Restraint Use	Most Severe Injury (TO BE COMPLETED BY ZONE CENTER)			
				Body Region	Injury Type	AIS	Injury Source
1	driver	l/front	manual non-mot L & S				
1	pass	r/front	manual non-mot L & S				

Body Region

Abdomen
 Ankle—foot
 Arm (upper)
 Back-thoracolumbar spine
 Brain
 Chest
 Ears
 Eye
 Elbow
 Face
 Forearm
 Head—skull
 Heart
 Kidneys
 Knee
 Leg (lower)
 Liver
 Lower limbs(s) (whole or unknown part)
 Mouth
 Neck—cervical spine
 Nose

Pelvic—hip
 Pulmonary—lungs
 Shoulder
 Spleen
 Thigh
 Thyroid, other endocrine gland
 Upper limb(s) (whole or unknown part)
 Vertebrae
 Whole body
 Wrist—hand

Injury Type

Abrasion
 Amputation
 Avulsion
 Burn
 Concussion
 Contusion
 Crush
 Detachment, separation
 Dislocation

Fracture
 Fracture and dislocation
 Laceration
 Other
 Perforation, puncture
 Rupture
 Sprain
 Strain
 Total severance, transection
 Unknown

Abbreviated Injury Scale

(1) Minor injury
 (2) Moderate injury
 (3) Serious injury
 (4) Severe injury
 (5) Critical injury
 (6) Maximum (untreatable)
 (7) Injured, unknown severity

DO NOT SANITIZE THIS FORM



U.S. Department of Transportation
National Highway Traffic Safety
Administration

ACCIDENT COLLISION DIAGRAM

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM





PSU No. 02

Case Number—Stratum 026G

Indicate
North



VEHICLE
ROLLS



W-BEAM
GUARDRAIL



SNOW
EMBANKMENT
ALONG
ROADSIDE

NB LANES ONLY

T-WAY

89 KPH
+2% G / BIT / SNOW + ICE
NO EVIDENCE
NOT TO SCALE

ACCIDENT COLLISION MEASUREMENT TABLE

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Primary Sampling Unit Number 02

Case Number—Stratum 0266

ACCIDENT COLLISION DIAGRAM		CRASH DATA																										
<p style="text-align: center;">LEVEL I</p> <p style="text-align: center;">PHYSICAL EVIDENCE ABSENT</p> <p>To be accomplished when there is no physical evidence present at the scene:</p> <ul style="list-style-type: none"> * approximate vehicle orientation at impact and final rest * applicable road/roadway delineation (e.g., curves/edge lines, lane markings, median markings, pavement markings, etc.) * applicable traffic controls (e.g., speed limit) * north arrow placed on diagram * sketch required 	<p style="text-align: center;">LEVEL II (Cont'd)</p> <p style="text-align: center;">physical evidence is present:</p> <ul style="list-style-type: none"> * document reference point and reference line relative to physical features present at the scene * scaled documentation of all accident induced physical evidence * scaled documentation of all roadside objects contacted * roadway surface type and condition of applicable roadways * grade measurements for all applicable roadways and at location of rollover initiation * scaled representations of the vehicle(s) at pre-impact, impact, and final rest based upon either: <div style="margin-left: 20px;"> a) physical evidence, or b) reconstructed accident dynamics </div> 	<table style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="width: 30%;"></th> <th style="width: 10%; text-align: center;">VEH. #1</th> <th style="width: 10%; text-align: center;">VEH. #2</th> <th style="width: 10%; text-align: center;">VEH. #3</th> </tr> </thead> <tbody> <tr> <td>Heading Angle</td> <td style="text-align: center;"><u>000</u></td> <td style="text-align: center;">_____</td> <td style="text-align: center;">_____</td> </tr> <tr> <td>Surface Type</td> <td style="text-align: center;"><u>BIT</u></td> <td style="text-align: center;">_____</td> <td style="text-align: center;">_____</td> </tr> <tr> <td>Surface Condition</td> <td style="text-align: center;"><u>SNOW/ICE</u></td> <td style="text-align: center;">_____</td> <td style="text-align: center;">_____</td> </tr> <tr> <td>Grade (v/h) Measurement (between impact and final rest)</td> <td style="text-align: center;"><u>+1/48</u></td> <td style="text-align: center;">_____</td> <td style="text-align: center;">_____</td> </tr> <tr> <td>Grade (v/h) Measurement (at location of rollover initiation)</td> <td colspan="3" style="text-align: center;"> <u>UNKNOWN - SNOW BANK AT</u> <u>TIME OF ACCIDENT</u> </td> </tr> </tbody> </table>				VEH. #1	VEH. #2	VEH. #3	Heading Angle	<u>000</u>	_____	_____	Surface Type	<u>BIT</u>	_____	_____	Surface Condition	<u>SNOW/ICE</u>	_____	_____	Grade (v/h) Measurement (between impact and final rest)	<u>+1/48</u>	_____	_____	Grade (v/h) Measurement (at location of rollover initiation)	<u>UNKNOWN - SNOW BANK AT</u> <u>TIME OF ACCIDENT</u>		
	VEH. #1	VEH. #2	VEH. #3																									
Heading Angle	<u>000</u>	_____	_____																									
Surface Type	<u>BIT</u>	_____	_____																									
Surface Condition	<u>SNOW/ICE</u>	_____	_____																									
Grade (v/h) Measurement (between impact and final rest)	<u>+1/48</u>	_____	_____																									
Grade (v/h) Measurement (at location of rollover initiation)	<u>UNKNOWN - SNOW BANK AT</u> <u>TIME OF ACCIDENT</u>																											
<p style="text-align: center;">LEVEL II</p> <p style="text-align: center;">PHYSICAL EVIDENCE PRESENT</p> <p>In addition to the level I tasks noted above, the following must be accomplished when</p>																												

Reference Point: _____ Reference line: _____

[illegible]

[illegible]



ACCIDENT FORM

1. Primary Sampling Unit Number

02

2. Case Number - Stratum

0266

IDENTIFICATION

3. Number of General Vehicle
Forms Submitted

01

4. Date of Accident
(Month, Day, Year)

09 04

5. Time of Accident

2050

Code reported military time of accident.

NOTE: Midnight = 2400
Unknown = 9999

SPECIAL STUDIES - INDICATORS

Check (✓) each special study (SS14-SS18 below) that has been completed; code 1 for the checked special studies and 0 for the special studies not checked.

6. 0 SS15 Administrative Use

0

7. 0 SS16 Pedestrian Crash Data Study

0

8. 0 SS17 Impact Fires

0

9. 0 SS18

0

10. 0 SS19

0

NUMBER OF EVENTS

11. Number of Recorded Events
in This Accident

01

Code the number of events which occurred
in this accident.

ACCIDENT EVENTS

For each event that occurred in the accident, code the lowest numbered vehicle in the left columns and the other involved vehicle or object on the right.

Accident Event Sequence Number	Vehicle Number	Class Of Vehicle	General Area of Damage	Vehicle Number or Object Contacted	Class Of Vehicle	General Area of Damage
12. <u>01</u>	13. <u>01</u>	14. <u>11</u>	15. <u>T</u>	16. <u>31</u>	17. <u>00</u>	18. <u>N</u>
19. <u>02</u>	20. <u> </u>	21. <u> </u>	22. <u> </u>	23. <u> </u>	24. <u> </u>	25. <u> </u>
26. <u>03</u>	27. <u> </u>	28. <u> </u>	29. <u> </u>	30. <u> </u>	31. <u> </u>	32. <u> </u>
33. <u>04</u>	34. <u> </u>	35. <u> </u>	36. <u> </u>	37. <u> </u>	38. <u> </u>	39. <u> </u>
40. <u>05</u>	41. <u> </u>	42. <u> </u>	43. <u> </u>	44. <u> </u>	45. <u> </u>	46. <u> </u>

IF GREATER THAN FIVE EVENTS, CONTINUE CODING ON THE ACCIDENT EVENT SUPPLEMENT

CODES FOR CLASS OF VEHICLE

- (00) Not a motor vehicle
- (01) Subcompact/mini (wheelbase < 254 cm)
- (02) Compact (wheelbase ≥ 254 but < 265 cm)
- (03) Intermediate (wheelbase ≥ 265 but < 278 cm)
- (04) Full size (wheelbase ≥ 278 but < 291 cm)
- (05) Largest (wheelbase ≥ 291 cm)
- (09) Unknown passenger car size
- (11) Compact utility vehicle
- (12) Large utility vehicle (≤ 4,500 kgs GVWR)
- (13) Passenger van (≤ 4,500 kgs GVWR)
- (14) Other van (≤ 4,500 kgs GVWR)
- (15) Pickup truck (≤ 4,500 kgs GVWR)
- (18) Other truck (≤ 4,500 kgs GVWR)
- (19) Unknown light truck type
- (20) School bus
- (21) Other bus
- (22) Truck (> 4,500 kgs GVWR)
- (23) Tractor without trailer
- (24) Tractor-trailer(s)
- (25) Motored cycle
- (28) Other vehicle
- (99) Unknown

CODES FOR GENERAL AREA OF DAMAGE (GAD)

CDS APPLICABLE AND OTHER VEHICLES

- (O) Not a motor vehicle
- (N) Noncollision
- (F) Front
- (R) Right side
- (L) Left side
- (B) Back
- (T) Top
- (U) Undercarriage
- (9) Unknown

TDC APPLICABLE VEHICLES

- (O) Not a motor vehicle
- (N) Noncollision
- (F) Front
- (R) Right side
- (L) Left side
- (B) Back of unit with cargo
area (rear of trailer or
straight truck)
- (D) Back (rear of tractor)
- (C) Rear of cab
- (V) Front of cargo area
- (T) Top
- (U) Undercarriage
- (9) Unknown

CODES FOR VEHICLE NUMBER OR OBJECT CONTACTED

(01-30) — Vehicle Number

Noncollision

- (31) Overturn — rollover
- (32) Fire or explosion
- (33) Jackknife
- (34) Other intraunit damage (specify): _____

(35) Noncollision injury

(38) Other noncollision (specify): _____

(39) Noncollision — details unknown

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

(45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in
diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)

(54) Concrete traffic barrier

(55) Impact attenuator

(56) Other traffic barrier (includes guardrail)
(specify): _____

(57) Fence

(58) Wall

(59) Building

(60) Ditch or culvert

(61) Ground

(62) Fire hydrant

(63) Curb

(64) Bridge

(68) Other fixed object (specify): _____

(69) Unknown fixed object

Collision with Nonfixed Object

(71) Motor vehicle not in-transport

(72) Pedestrian

(73) Cyclist or cycle

(74) Other nonmotorist or conveyance

(75) Vehicle occupant

(76) Animal

(77) Train

(78) Trailer, disconnected in transport

(79) Object fell from vehicle in-transport

(88) Other nonfixed object (specify): _____

(89) Unknown nonfixed object

(98) Other event (specify): _____

(99) Unknown event or object

OCCUPANT RELATED

16. Driver Presence in Vehicle 1
(0) Driver not present
(1) Driver present
(9) Unknown
17. Number of Occupants This Vehicle 02
(00-96) Code actual number of occupants
for this vehicle
(97) 97 or more
(99) Unknown
18. Number of Occupant Forms Submitted 02

VEHICLE WEIGHT ITEMS

19. Vehicle Curb Weight 1,900
Code weight to nearest
10 kilograms.
(045) Less than 450 kilograms
(610) 6,100 kilograms or more
(999) Unknown
4,185 lbs X .4536 = 1,898 kgs
Source: [REDACTED]
20. Vehicle Cargo Weight 9,990
Code weight to nearest
10 kilograms.
(000) Less than 5 kilograms
(450) 4,500 kilograms or more
(999) Unknown
_____, _____ lbs X .4536 = _____ kgs

RECONSTRUCTION DATA

21. Towed Trailing Unit 0
(0) No towed unit
(1) Yes—towed trailing unit
(9) Unknown
22. Documentation of Trajectory Data
for This Vehicle 0
(0) No
(1) Yes
23. Post Collision Condition of Tree or Pole
(For Highest Delta V) 0
(0) Not collision (for highest delta V) with
tree or pole
(1) Not damaged
(2) Cracked/sheared
(3) Tilted < 45 degrees
(4) Tilted ≥ 45 degrees
(5) Uprooted tree
(6) Separated pole from base
(7) Pole replaced
(8) Other (specify): _____
(9) Unknown

24. Rollover 4
(0) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
(1) Rollover, 1 quarter turn only
(2) Rollover, 2 quarter turns
(3) Rollover, 3 quarter turns
(4) Rollover, 4 or more quarter turns (specify):
4 x's
(5) Rollover--end-over-end (i.e., primarily
about the lateral axis)
(9) Rollover (overturn), details unknown



















































OVERRIDE/UNDERRIDE (THIS VEHICLE)

25. Front Override/Underride (this Vehicle) 0
26. Rear Override/Underride (this Vehicle) 0
(0) No override/underride, or
not an end-to-end impact
Override (see specific CDC)
(1) 1st CDC
(2) 2nd CDC
(3) Other not automated CDC (specify): _____
Underride (see specific CDC)
(4) 1st CDC
(5) 2nd CDC
(6) Other not automated CDC (specify): _____
(7) Medium/heavy truck or bus override
(9) Unknown

HEADING ANGLE AT IMPACT FOR
HIGHEST DELTA V

Values: (000)-(359) Code actual value
(997) Noncollision
(998) Impact with object
(999) Unknown

27. Heading Angle For This Vehicle 997
28. Heading Angle For Other Vehicle 997

Category	Configuration	ACCIDENT TYPES (Includes Intent)				
I Single Driver	A Right Roadside Departure	 01 DRIVE OFF ROAD	 02 CONTROL/ TRACTION LOSS	 03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN
	B Left Roadside Departure	 06 DRIVE OFF ROAD	 07 CONTROL/ TRACTION LOSS	 08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN
	C Forward Impact	 11 PARKED VEH.	 12 STA. OBJECT	 13 PEDESTRIAN/ ANIMAL	 14 END DEPARTURE	15 SPECIFICS OTHER 16 SPECIFICS UNKNOWN
II Same Trafficway Same Direction	D Rear-End	 20 STOPPED 21, 22, 23	 22 SLOWER 24, 25, 27	 24 DECEL. 28, 30, 31	 26 AVOID COLLISION WITH VEH.	(EACH - 32) SPECIFICS OTHER (EACH - 33) SPECIFICS UNKNOWN
	E Forward Impact	 34 CONTROL/ TRACTION LOSS	 36 CONTROL/ TRACTION LOSS	 38 AVOID COLLISION WITH VEH.	 40 AVOID COLLISION WITH OBJECT	(EACH - 42) SPECIFICS OTHER (EACH - 43) SPECIFICS UNKNOWN
	F Sideswipe Angle	 44 LATERAL MOVE	 46 LATERAL MOVE	 48 AVOID COLLISION WITH VEH.	 50 AVOID COLLISION WITH OBJECT	(EACH - 48) SPECIFICS OTHER (EACH - 49) SPECIFICS UNKNOWN
III Same Trafficway Opposite Direction	G Head-On	 50 LATERAL MOVE	 52 AVOID COLLISION WITH VEH.	 54 AVOID COLLISION WITH OBJECT	 56 AVOID COLLISION WITH VEH.	(EACH - 52) SPECIFICS OTHER (EACH - 53) SPECIFICS UNKNOWN
	H Forward Impact	 54 CONTROL/ TRACTION LOSS	 56 CONTROL/ TRACTION LOSS	 58 AVOID COLLISION WITH VEH.	 60 AVOID COLLISION WITH OBJECT	(EACH - 52) SPECIFICS OTHER (EACH - 53) SPECIFICS UNKNOWN
	I Sideswipe Angle	 64 LATERAL MOVE	 66 LATERAL MOVE	 68 AVOID COLLISION WITH VEH.	 70 AVOID COLLISION WITH OBJECT	(EACH - 64) SPECIFICS OTHER (EACH - 65) SPECIFICS UNKNOWN
IV Change Trafficway Vehicle Turning	J Turn Across Path	 68 INITIAL OPPOSITE DIRECTIONS	 70 INITIAL SAME DIRECTIONS	 72 INITIAL OPPOSITE DIRECTIONS	 74 INITIAL SAME DIRECTIONS	(EACH - 74) SPECIFICS OTHER (EACH - 75) SPECIFICS UNKNOWN
	K Turn Into Path	 76 TURN INTO SAME DIRECTION	 78 TURN INTO OPPOSITE DIRECTIONS	 80 TURN INTO SAME DIRECTION	 82 TURN INTO OPPOSITE DIRECTIONS	(EACH - 80) SPECIFICS OTHER (EACH - 81) SPECIFICS UNKNOWN
V Intersecting Paths (Vehicle Damage)	L Straight Paths	 87 INTERSECTING PATHS	 89 INTERSECTING PATHS	 91 INTERSECTING PATHS	 93 INTERSECTING PATHS	(EACH - 87) SPECIFICS OTHER (EACH - 88) SPECIFICS UNKNOWN
VI Miscellaneous	M Backing Etc	 92 BACKING VEH.	 94 OTHER VEH. OR OBJECT	 96 OTHER ACCIDENT TYPE	 98 UNKNOWN ACCIDENT TYPE	99 NO IMPACT

OTHER DATA

56. Driver's Zip Code

- (00000) Driver not present
(00001) Driver not a resident of U.S. or territories
Code actual 5-digit zip code
(99999) Unknown

57. Driver's Race/Ethnic Origin

- (0) Driver not present
(1) White (non-Hispanic)
(2) Black (non-Hispanic)
(3) White (Hispanic)
(4) Black (Hispanic)
(5) American Indian, Eskimo or Aleut
(6) Asian or Pacific Islander
(8) Other (specify):
(9) Unknown

58. Vehicle Special Use (This Trip)

- (0) No special use
(1) Taxi
(2) Vehicle used as school bus
(3) Vehicle used as other bus
(4) Military
(5) Police
(6) Ambulance
(7) Fire truck or car
(8) Other (specify):
(9) Unknown

ROLLOVER DATA

If GV07 (Body Type) \neq 1-49, leave GV59-GV63 blank.
If GV24 (Rollover) = 0, then GV59-GV63 must equal 0.
If GV24 = 9, then GV59-GV63 must equal 9.

59. Rollover Initiation Type

- (0) No rollover
(1) Trip-over
(2) Flip-over
(3) Turn-over
(4) Climb-over
(5) Fall-over
(6) Bounce-over
(7) Collision with another vehicle
(8) Other rollover initiation type specify:
(9) Unknown rollover initiation type

60. Location of Rollover Initiation

- (0) No rollover
(1) On roadway
(2) On shoulder—paved
(3) On shoulder—unpaved
(4) On roadside or divided trafficway median
(9) Unknown

61. Rollover Initiation Object Contacted

62. Location on Vehicle Where Initial Principal Tripping Force Is Applied

- (0) No rollover
(1) Wheels/tires
(2) Side plane
(3) End plane
(4) Undercarriage
(5) Other location on vehicle (specify):
(8) Non-contact rollover forces (specify):
(9) Unknown

63. Direction of Initial Roll

- (0) No rollover
(1) Roll right - primarily about the longitudinal axis
(2) Roll left - primarily about the longitudinal axis
(5) End-over-end (i.e., primarily about the lateral axis)
(9) Unknown roll direction

PRECRASH DATA

64. Pre-Event Movement (Prior to Recognition of Critical Event)

- (01) Going straight
(02) Slowing or stopping in traffic lane
(03) Starting in traffic lane
(04) Stopped in traffic lane
(05) Passing or overtaking another vehicle
(06) Disabled or parked in travel lane
(07) Leaving a parking position
(08) Entering a parking position
(09) Turning right
(10) Turning left
(11) Making a U-turn
(12) Backing up (other than for parking position)
(13) Negotiating a curve
(14) Changing lanes
(15) Merging
(16) Successful avoidance maneuver to a previous critical event
(97) Other (specify):
(98) No driver present
(99) Unknown

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

(00) No rollover
(01-30) — Vehicle Number

Noncollision

(31) Turn-over — fall-over
(33) Jackknife

Collision With Fixed Object

(41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment

(45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

(50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

(54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify): _____

(57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

(69) Unknown fixed object

Collision with Nonfixed Object

(71) Motor vehicle not in-transport
(76) Animal
(77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):

(89) Unknown nonfixed object

(98) Other event (specify):

(99) Unknown event or object

EXTERIOR VEHICLE FORM

**NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM**

Administration	Street Name
1. Primary Sampling Unit Number	02
2. Case Number - Stratum	0266
3. Vehicle Number	01

VEHICLE IDENTIFICATION

VIN JT3VN39WXLO [REDACTED] Model Year 90
Vehicle Make (specify): TOYOTA Vehicle Model (specify): 4-RUNNER

LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
	ROLLOVER	

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure and document on the vehicle diagram the location of maximum crush.

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

[illegible]

ORIGINAL SPECIFICATIONS WORK SHEET


Wheelbase	<u>1</u> <u>0</u> <u>3</u> . <u>0</u>	inches	x 2.54	=	<u>2</u> <u>6</u> <u>1</u>	cm
Overall Length	<u>1</u> <u>7</u> <u>6</u> . <u>0</u>	inches	x 2.54	=	<u>4</u> <u>4</u> <u>7</u>	cm
Maximum Width	<u> </u> <u>6</u> <u>6</u> . <u>5</u>	inches	x 2.54	=	<u>1</u> <u>6</u> <u>9</u>	cm
Curb Weight	<u> </u> <u>4</u> , <u>1</u> <u>8</u> <u>5</u>	pounds	x .4536	=	<u>1</u> , <u>8</u> <u>9</u> <u>8</u>	kg
Average Track	<u> </u> <u>6</u> <u>1</u> . <u>0</u>	inches	x 2.54	=	<u>1</u> <u>5</u> <u>6</u>	cm
Front Overhang	<u> </u> <u>NA</u> . <u> </u>	inches	x 2.54	=	<u> </u> <u> </u> <u> </u>	cm
Rear Overhang	<u> </u> <u>NA</u> . <u> </u>	inches	x 2.54	=	<u> </u> <u> </u> <u> </u>	cm
Undeformed End Width	<u> </u> <u>6</u> <u>0</u> . <u> </u>	inches	x 2.54	=	<u>1</u> <u>5</u> <u>2</u>	cm
Engine Size: cyl./displ.	<u>2</u> <u>9</u> <u>5</u> <u>8</u>	cc	x .001	=	<u>3</u> . <u>0</u>	L
	<u> </u> <u> </u> <u> </u>	CID	x .0164	=	<u> </u> . <u> </u>	L

V6

VEHICLE DAMAGE SKETCH

TIRE—WHEEL DAMAGE a. Rotation physically restricted RF <u>2</u> LF <u>2</u> RR <u>2</u> LR <u>2</u> (1) Yes (2) No (8) NA (9) Unk.		ORIGINAL SPECIFICATIONS Wheelbase <u>261</u> cm Overall Length <u>447</u> cm Maximum Width <u>169</u> cm Curb Weight <u>1898</u> kg Average Track <u>156</u> cm Front Overhang <u>NA</u> cm Rear Overhang <u>NA</u> cm Undeformed End Width <u>152</u> cm Engine Size: cyl./displ. <u>V6 / 3.0</u> L		WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only) RF ± <u> </u> ° LF ± <u> </u> ° RR ± <u> </u> ° LR ± <u> </u> ° Within ± 5 degrees
TYPE OF TRANSMISSION <input checked="" type="checkbox"/> Manual <input type="checkbox"/> Automatic		DRIVE WHEELS <input type="checkbox"/> FWD <input type="checkbox"/> RWD <input checked="" type="checkbox"/> 4WD		
		Approximate Cargo Weight <u> </u> kg		

MEASUREMENTS IN CENTIMETERS

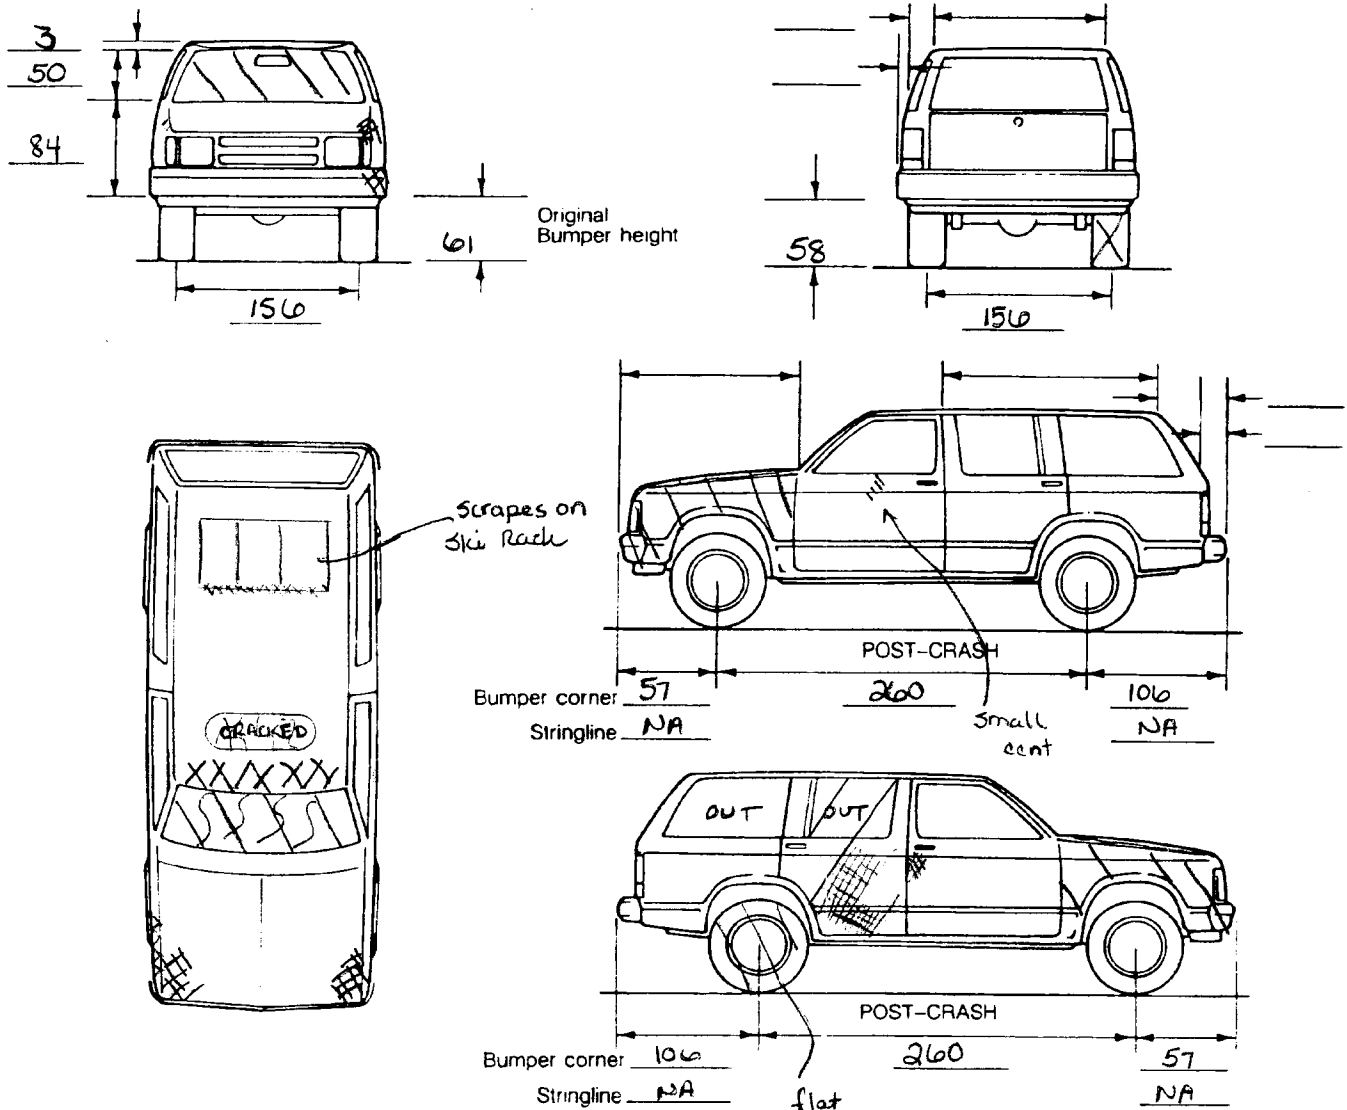

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>31</u>	6. <u>00</u>	7. <u>T</u>	8. <u>D</u>	9. <u>D</u>	10. <u>O</u>	11. <u>φ2</u>

Second Highest Delta "V"

12. _____	13. _____	14. _____	15. _____	16. _____	17. _____	18. _____	19. _____
-----------	-----------	-----------	-----------	-----------	-----------	-----------	-----------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. <u>L</u>	21. <u>C₁</u>	<u>C₂</u>	<u>C₃</u>	<u>C₄</u>	<u>C₅</u>	<u>C₆</u>	22. <u>±D</u>
_____	_____	_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____	_____	_____

Second Highest Delta "V"

23. <u>L</u>	24. <u>C₁</u>	<u>C₂</u>	<u>C₃</u>	<u>C₄</u>	<u>C₅</u>	<u>C₆</u>	25. <u>±D</u>
_____	_____	_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____	_____	_____

26. Are CDCs Documented but Not Coded on The Automated File? 0
(0) No
(1) Yes

27. Researcher's Assessment of Vehicle Disposition 1
(0) Not towed due to vehicle damage
(1) Towed due to vehicle damage
(9) Unknown

28. Original Wheelbase 261
Code to the nearest centimeter
(999) Unknown

103.0 inches X 2.54 = 261 centimeters

29. Is This A Multi-Stage Manufactured Vehicle
And/Or A Certified Altered Vehicle?

0

- (0) No post manufacturer modifications
(1) Yes - post manufacturer modifications
(specify): _____

(Include photograph of CERTIFICATION
PLACARD in case report)

- (9) Unknown if vehicle is modified

30. Fire Occurrence

0

- (0) No fire

Yes, fire occurred

- (1) Minor
(2) Major
(9) Unknown

31. Origin of Fire

0

- (0) No fire
(1) Vehicle exterior (front, side, back, top)
(2) Exhaust system
(3) Fuel tank (and other fuel retention
system parts)
(4) Engine compartment
(5) Cargo/trunk compartment
(6) Instrument panel
(7) Passenger compartment area
(8) Other location (specify): _____

- (9) Unknown

32. Type of Fuel Tank-1

1

33. Type of Fuel Tank-2

0

- (0) No fuel tank (electrical vehicle)
(1) Metallic
(2) Non-metallic
(9) Unknown

34. Fuel Tank-1 Location

6

35. Fuel Tank-2 Location

0

- (0) No fuel tank
(1) Aft of center of the rear wheels (rear axle)
centered
(2) Aft of center of the rear wheels (rear axle)
left side
(3) Aft of center of the rear wheels (rear axle)
right side
(4) Forward of center of the rear wheels (rear
axle) centered
(5) Forward of center of the rear wheels (rear
axle) left side
(6) Forward of center of the rear wheels (rear
axle) right side
(7) Over center of the rear wheels (rear axle)
(8) Other (specify): _____
(9) Unknown

36. Fuel Tank-1 Filler Cap Location

7

37. Fuel Tank-2 Filler Cap Location

0

- (0) No fuel tank
(1) On back plane
(2) Aft of center of the rear wheels (rear axle) on
left side plane
(3) Aft of center of the rear wheels (rear axle) on
right side plane
(4) Forward of center of the rear wheels (rear
axle) on left side plane
(5) Forward of center of the rear wheels (rear
axle) on right side plane
(6) Over the center of the rear wheels (rear axle)
on left side plane
(7) Over the center of the rear wheels (rear axle)
on right side plane
(8) Other (specify): _____
(9) Unknown

38. Fuel Tank-1 Damage

1

39. Fuel Tank-2 Damage

0

- (0) No fuel tank
(1) No damage to fuel tank
(2) Deformed, no seam failure
(3) Deformed, with a seam failure
(4) Punctured
(5) Lacerated (ripped)
(6) Abraded (scraped)
(7) Filler neck separation from the fuel tank
(8) Other damage (specify): _____
(9) Unknown

40. Location of Fuel System-1 Leakage

1

41. Location of Fuel System-2 Leakage

0

(0) No fuel tank

(1) No fuel leakage

Primary Area Of Leakage

(2) Tank

(3) Filler neck

(4) Cap

(5) Lines/pump/filter

(6) Vent/emission recovery

(8) Other (specify):

(9) Unknown

42. Fuel Type-1

01

43. Fuel Type-2

00*Single Fuel Type*

(00) No fuel tank

(01) Gasoline

(02) Diesel

(03) CNG (Compressed Natural Gas)

(04) LPG (Liquid Petroleum Gas) also known as Propane

(05) LNG (Liquid Natural Gas)

(06) Methanol (M100 or M85)

(07) Ethanol (E100 or E85)

(08) Other (Hydrogen or others) (specify):

Electric Powered or Electric/Solar Powered Vehicles

(10) Lead Acid Battery

(11) Nickel-Iron Battery

(12) Nickel-Cadmium Battery

(13) Sodium Metal Chloride Battery

(14) Sodium Sulfur Battery

(18) Other (Specify):

(98) Other Hybrid (specify):

(99) Unknown fuel type

44. Is This Vehicle Equipped With More Than Two Fuel Tanks?

0

(0) No (one or two tanks only)

Yes - More Than Two Tanks(1) Yes -- no damage to any tank or filler cap and no fuel system leakage(2) Yes -- no damage to any tank or filler cap but there is fuel system leakage (specify leakage location):(3) Yes -- damage to an additional tank or filler cap and there is fuel system leakage (specify the following):

Type of tank

Tank location

Filler cap location

Tank damage

Location of leakage

Type of fuel

(9) Unknown if more than two tanks

COMMENTS

*** STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED AND WAS NOT AN AOPS ***
 (I.E., GV09 = 0 OR 9 AND GV36 = 0), DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 02

2. Case Number - Stratum 026G

3. Vehicle Number 01

INTEGRITY

4. Passenger Compartment Integrity 06

(00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):

(99) Unknown

Door, Tailgate or Hatch Opening

5. LF 1 6. RF 1 7. LR 1 8. RR 1 9. TG/H 1

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify):

(9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify):

(9) Unknown

GLAZING

Glazing Damage from Impact Forces

15. WS 2 16. LF 0 17. RF 0 18. LR 0 19. RR 6
20. BL 0 21. Roof 2 22. Other 6

- (0) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (8) No glazing
- (9) Unknown if damaged

Glazing Damage from Occupant Contact

23. WS 0 24. LF 0 25. RF 0 26. LR 0 27. RR 0
28. BL 0 29. Roof 0 30. Other 0

- (0) No occupant contact to glazing or no glazing
- (1) Glazing contacted by occupant but no glazing damage
- (2) Glazing in place and cracked by occupant contact
- (3) Glazing in place and holed by occupant contact
- (4) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (5) Glazing out-of-place by occupant contact and holed by occupant contact
- (6) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

If No Glazing Damage **And** No Occupant Contact or No Glazing, Then Code IV31 Through IV46 As 0

Type of Window/Windshield Glazing

31. WS 1 32. LF 0 33. RF 0 34. LR 0 35. RR 2
36. BL 0 37. Roof 3 38. Other 2

- (0) No glazing contact and no damage, or no glazing
- (1) AS-1 - Laminated
- (2) AS-2 - Tempered
- (3) AS-3 - Tempered-tinted
- (4) AS-14 - Glass/Plastic
- (8) Other (specify):

(9) Unknown


Window Precrash Glazing Status

39. WS 1 40. LF 0 41. RF 0 42. LR 0 43. RR 2
44. BL 0 45. Roof 2 46. Other 1

- (0) No glazing contact and no damage, or no glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (9) Unknown

INTRUSION WORKSHEET

Note: Sketch intruded areas

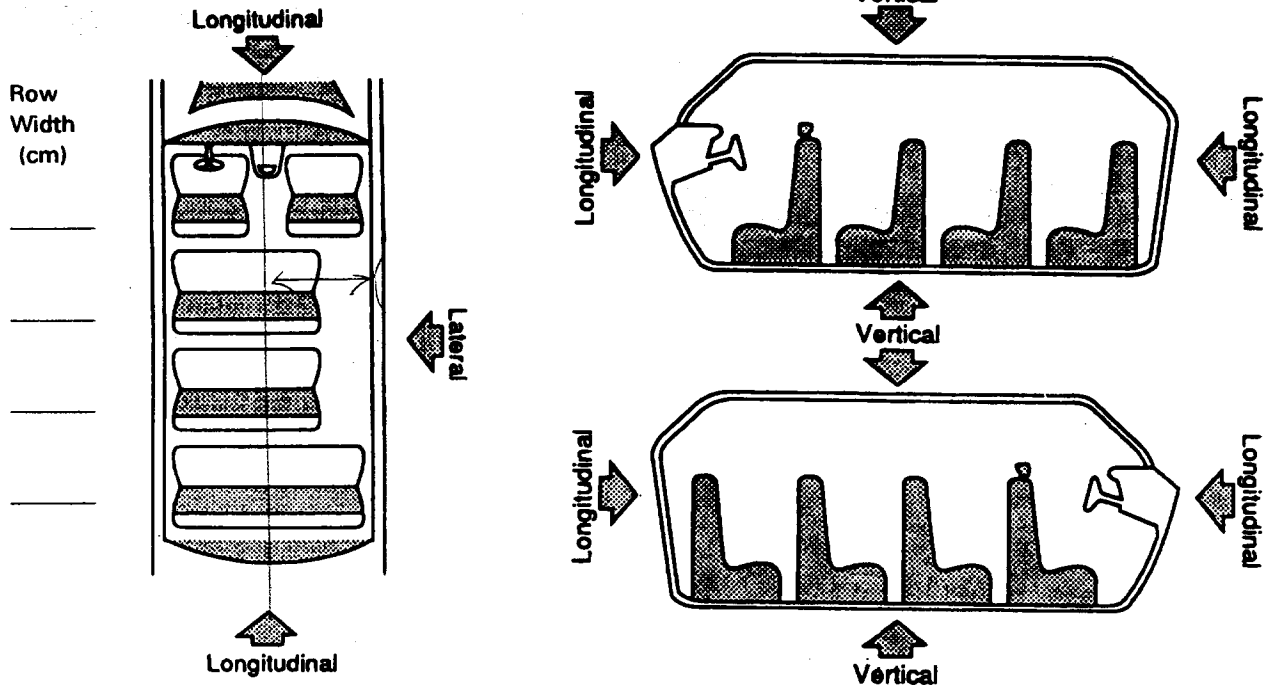

LOCATION OF INTRUSION	INTRUDED COMPONENT	(All Measurements Are In Centimeters)				DOMINANT CRUSH DIRECTION
		COMPARISON VALUE	—	INTRUDED VALUE	=	
23	door panel (10)	69	—	66	= 3	lat
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	
			—		=	

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. <u>23</u>	48. <u>10</u>	49. <u>1</u>	50. <u>3</u>
2nd	51. _____	52. _____	53. _____	54. _____
3rd	55. _____	56. _____	57. _____	58. _____
4th	59. _____	60. _____	61. _____	62. _____
5th	63. _____	64. _____	65. _____	66. _____
6th	67. _____	68. _____	69. _____	70. _____
7th	71. _____	72. _____	73. _____	74. _____
8th	75. _____	76. _____	77. _____	78. _____
9th	79. _____	80. _____	81. _____	82. _____
10th	83. _____	84. _____	85. _____	86. _____

LOCATION OF INTRUSION

Front Seat
 (11) Left
 (12) Middle
 (13) Right

Second Seat
 (21) Left
 (22) Middle
 (23) Right

Third Seat
 (31) Left
 (32) Middle
 (33) Right

Fourth Seat
 (41) Left
 (42) Middle
 (43) Right

(97) Catastrophic
 (98) Other enclosed area (specify)

(99) Unknown

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Door panel (side)
- (12) Roof (or convertible top)
- (13) Roof side rail
- (14) Windshield
- (15) Windshield header
- (16) Window frame
- (17) Floor pan (includes sill)
- (18) Backlight header
- (19) Front seat back
- (20) Second seat back
- (21) Third seat back
- (22) Fourth seat back
- (23) Fifth seat back
- (24) Seat cushion
- (25) Back door/panel (e.g., tailgate)
- (26) Other interior component (specify):

- (27) Side panel - forward of the A (A2)-pillar
- (28) Side panel - rear of the A (A2)-pillar

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify):
- (32) Other exterior object in the environment (specify):
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify):
- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)

COMPARISON VALUE — DAMAGE VALUE = DEFORMATION

— =

— =

— =

— =

STEERING COLUMN

87. Steering Column Type 2

- (1) Fixed column
 (2) Tilt column
 (3) Telescoping column
 (4) Tilt and telescoping column
 (8) Other column type (specify): _____

(9) Unknown

88. Blank X X

(This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.

89. Blank X X X

(This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.

90. Blank X X X

(This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.

91. Blank X X X

(This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.

92. Steering Rim/Spoke Deformation 0 0

Code actual measured

- deformation to the nearest centimeter
 (00) No steering rim deformation
 (01-14) Actual measured value in centimeters
 (15) 15 centimeters or more
 (98) Observed deformation cannot be measured
 (99) Unknown

93. Location of Steering Rim/Spoke 0 0

Deformation

- (00) No steering rim deformation


Quarter Sections

- (01) Section A
 (02) Section B
 (03) Section C
 (04) Section D



Half Sections

- (05) Upper half of rim/spoke
 (06) Lower half of rim/spoke
 (07) Left half of rim/spoke
 (08) Right half of rim/spoke



- (09) Complete steering wheel collapse
 (10) Undetermined location
 (99) Unknown

INSTRUMENT PANEL

94. Odometer Reading 1 7 8,000

_____ kilometers—Code to the nearest 1,000 kilometers

- (000) No odometer
 (001) Less than 1,500 kilometers
 (500) 499,500 kilometers or more
 (999) Unknown

110,322.1 miles X 1.6093 = 177,543 kilometers

Source: _____

95. Instrument Panel Damage from Occupant Contact? 0

- (0) No
 (1) Yes
 (9) Unknown

96. Knee Bolsters Deformed from Occupant Contact? 8





- (0) No
 (1) Yes
 (8) Not present
 (9) Unknown

97. Did Glove Compartment Door Open During Collision(s)? 0

- (0) No
 (1) Yes
 (8) Not present
 (9) Unknown

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

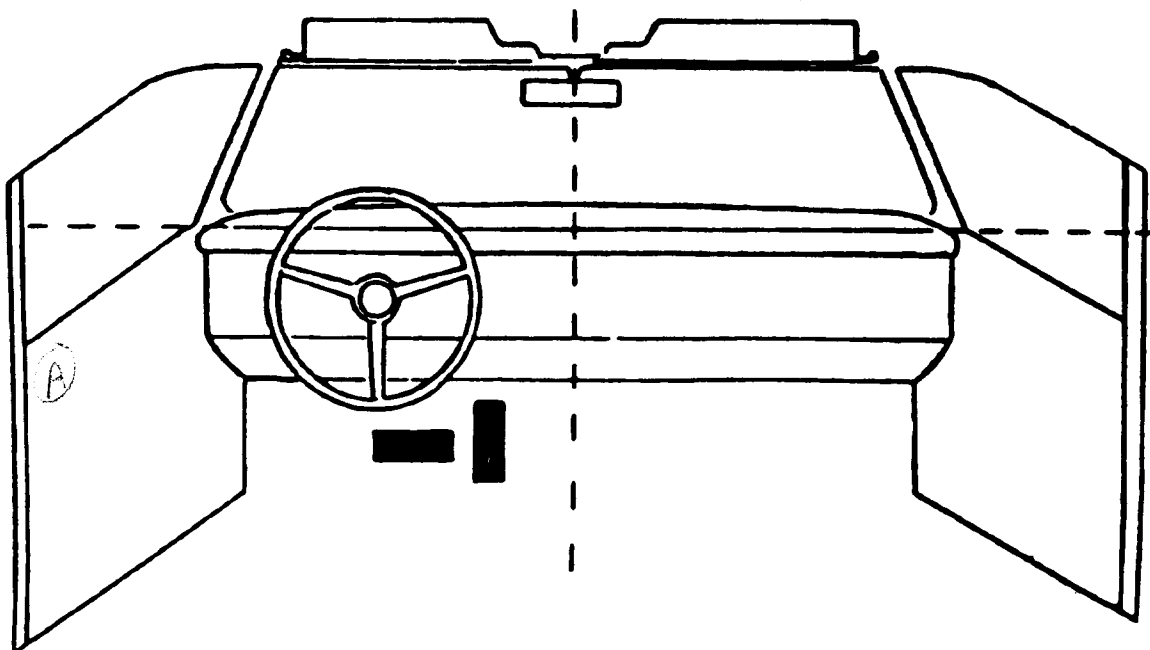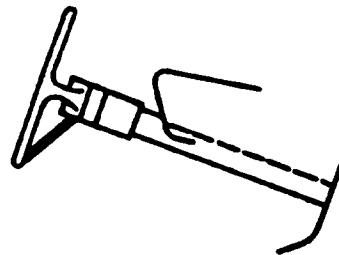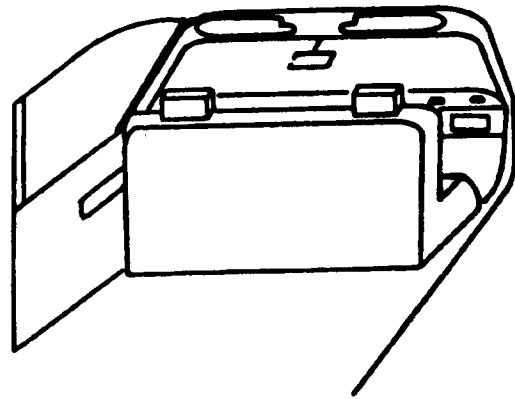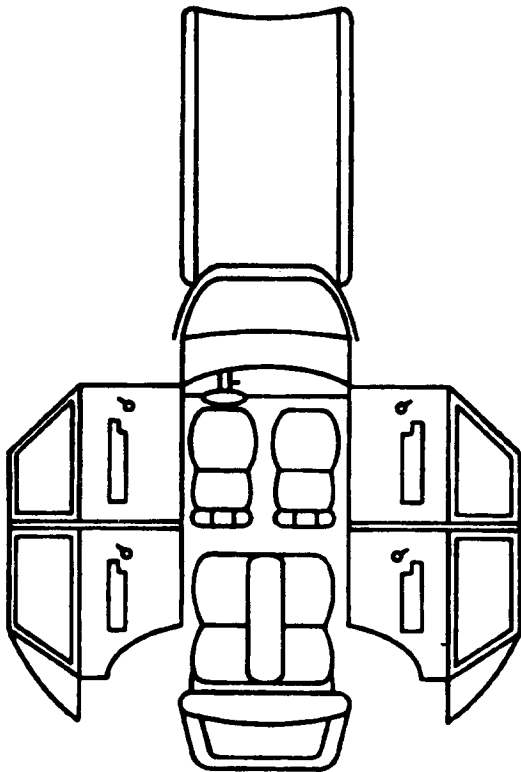

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).

Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.

Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	20/21	01	arm/leg	possible white cloth transfer	2
B					
C					
D					
E					
F					
G					
H					
I					
J					
K					
L					
M					
N					

CODES FOR INTERIOR COMPONENTS

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar

- (23) Left B-pillar

- (24) Other left pillar (specify): _____

- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____

- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____
- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B pillar, or roof side rail.
- (37) Other right side object (specify): _____
- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)

- (46) Other occupants (specify): _____

- (47) Interior loose objects

- (48) Child safety seat (specify): _____

- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)
- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Left	Right
F I R S T	Availability/Function	○	○
	Deployment	○	○
	Failure	○	○

Air Bag System Availability/Function

- (0) Not equipped/not available
(1) Air bag

Non-functional

- (2) Air bag disconnected (specify):

(3) Air bag not reinstalled
(9) Unknown

Air Bag System Deployment

- (0) Not equipped/not available
(1) Air bag deployed during accident (as a result of impact)
(2) Air bag deployed inadvertently just prior to accident
(3) Air bag deployed, accident sequence undetermined
(4) Nondeployed
(5) Unknown if deployed
(6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
(9) Unknown

Are There Indications of Air Bag System Failure?

- (0) Not equipped/not available
(1) No
(2) Yes (specify):

(9) Unknown

AUTOMATIC BELTS

		Left	Right
F I R S T	Availability/Function	○	○
	Use	○	○
	Type	○	○
	Proper Use	○	○
	Failure Modes	○	○

Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
(1) 2 point automatic belts
(2) 3 point automatic belts
(3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
(9) Unknown

Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
(1) Automatic belt in use
(2) Automatic belt not in use (manually disconnected, motorized track inoperative)
(3) Automatic belt use unknown
(9) Unknown

Automatic (Passive) Belt System Type

- (0) Not equipped/not available
(1) Non-motorized system
(2) Motorized system
(9) Unknown

Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
(1) Automatic belt used properly
(2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
(4) Automatic shoulder belt worn behind back
(5) Automatic belt worn around more than one person
(6) Lap portion of automatic belt worn on abdomen
(7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):

(8) Other improper use of automatic belt system (specify):

(9) Unknown

Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
(1) No automatic belt failure(s)
(2) Torn webbing (stretched webbing not included)
(3) Broken buckle or latchplate
(4) Upper anchorage separated
(5) Other anchorage separated (specify):

(6) Broken retractor
(7) Combination of above (specify):

(8) Other automatic belt failure (specify):

(9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for **each seat position** in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

If a Child safety seat is present, encode the data on the back of this page.

If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
FIRST	Availability	4	0	4
	Evidence of usage	04	00	04
	Used in this crash?	04	00	04
	Proper Use	1	0	1
	Failure Modes	1	0	1
SECOND	Availability	4	0	4
	Evidence of usage	04	00	04
	Used in this crash?	00	00	00
	Proper Use	0	0	0
	Failure Modes	0	0	0
OTHER	Availability			
	Evidence of usage			
	Used in this crash?			
	Proper Use			
	Failure Modes			

Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown

Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____
- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____
- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown

Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

1. Type of Child Safety Seat

(0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat
 (7) Other type child safety seat (specify): _____

(8) Unknown child safety seat type
 (9) Unknown if child safety seat used

2. Child Safety Seat Orientation

(00) No child safety seat

Designed for Rear Facing for This Age/Weight
 (01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify): _____

(09) Unknown orientation

Designed for Forward Facing for This Age/Weight
 (11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify): _____

(19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 (21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify): _____

(29) Unknown orientation

(99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage

4. Child Safety Seat Shield Usage

5. Child Safety Seat Tether Usage
 Note: Options Below Are Used for Variables 3-5.

(00) No child safety seat

Not Designed with Harness/Shield/Tether
 (01) After market harness/shield/tether added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market harness/shield/tether added
 (09) Unknown if harness/shield/tether added or used

Designed With Harness/Shield/Tether
 (11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether
 (21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

6. Child Safety Seat Make/Model
 (Specify make/model and occupant number)

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
FIRST	Head Restraint Type/Damage	3	0	3
	Seat Type	01	00	01
	Seat Performance	1	0	1
	Seat Orientation	1	0	1
SECOND	Head Restraint Type/Damage	3	0	3
	Seat Type	07	07	07
	Seat Performance	1	1	1
	Seat Orientation	1	1	1
THIRD	Head Restraint Type/Damage			
	Seat Type			
	Seat Performance			
	Seat Orientation			
OTHER	Head Restraint Type/Damage			
	Seat Type			
	Seat Performance			
	Seat Orientation			

Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
 (1) Integral — no damage
 (2) Integral — damaged during accident
 (3) Adjustable — no damage
 (4) Adjustable — damaged during accident
 (5) Add-on — no damage
 (6) Add-on — damaged during accident
 (8) Other Specify: _____
 (9) Unknown _____

Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Other seat type (specify): _____
 (10) Box mounted seat (i.e., van type)
 (99) Unknown _____

Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
 (1) No seat performance failure(s)
 (2) Seat adjusters failed
 (3) Seat back folding locks or "seat back" failed specify: _____
 (4) Seat tracks/anchors failed
 (5) Deformed by impact of occupant
 (6) Deformed by passenger compartment intrusion (specify): _____
 (7) Combination of above (specify): _____
 (8) Other (specify): _____
 (9) Unknown _____

Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify): _____
 (9) Unknown _____

DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No ☒ Yes ☐

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

- (8) Other area (e.g., back of pickup, etc.) (specify):

(9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

(5) Integral structure

- (8) Other medium (specify):

(9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No ☒ Yes ☐

Describe entrapment mechanism: _____

Component(s): _____

(Note in vehicle interior diagram)



OCCUPANT ASSESSMENT FORM

OCCUPANT'S SEATING	
1. Primary Sampling Unit Number <u>02</u>	10. Occupant's Seat Position <u>11</u>
2. Case Number - Stratum <u>0266</u>	<i>Front Seat</i>
3. Vehicle Number <u>01</u>	(11) Left side
4. Occupant Number <u>01</u>	(12) Middle
(13) Right side	
(14) Other (specify): _____	
(15) On or in the lap of another occupant	
<i>Second Seat</i>	
(21) Left side	
(22) Middle	
(23) Right side	
(24) Other (specify): _____	
(25) On or in the lap of another occupant	
<i>Third Seat</i>	
(31) Left side	
(32) Middle	
(33) Right side	
(34) Other (specify): _____	
(35) On or in the lap of another occupant	
<i>Fourth Seat</i>	
(41) Left side	
(42) Middle	
(43) Right side	
(44) Other (specify): _____	
(45) On or in the lap of another occupant	
(97) In or on unenclosed area	
(98) Other seat (specify): _____	
(99) Unknown	
11. Occupant's Posture <u>9</u>	
(0) Normal posture	
<i>Abnormal posture</i>	
(1) Kneeling or standing on seat	
(2) Lying on or across seat	
(3) Kneeling, standing or sitting in front of seat	
(4) Sitting sideways or turned to talk with another occupant or to look out a rear window	
(5) Sitting on a console	
(6) Lying back in a reclined seat position	
(7) Bracing with feet or hands on a surface in front of seat	
(8) Other abnormal posture (specify): _____	
(9) Unknown	

OCCUPANT'S CHARACTERISTICS	
5. Occupant's Age <u>28</u>	
Code actual age at time of accident.	
(00) Less than one year old (specify by month): _____	
(97) 97 years and older	
(99) Unknown	
6. Occupant's Sex <u>1</u>	
(1) Male	
(2) Female	
(9) Unknown	
7. Occupant's Height <u>999</u>	
Code actual height to the nearest centimeter.	
(999) Unknown	
_____ inches X 2.54 = _____ centimeters	
8. Occupant's Weight <u>999</u>	
Code actual weight to the nearest kilogram.	
(999) Unknown	
_____ pounds X .4536 = _____ kilograms	
9. Occupant's Role <u>1</u>	
(1) Driver	
(2) Passenger	
(9) Unknown	

EJECTION/ENTRAPMENT

12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

(NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)

- (0) Not entrapped
- (1) Entrapped
- (9) Unknown

RESTRAINT SYSTEM EVALUATION

17. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown _____

18. Manual (Active) Belt System Use 04

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

(02) Shoulder belt _____

(03) Lap belt _____

(04) Lap and shoulder belt _____

(05) Belt used—type unknown _____

(08) Other belt used (specify): _____

(12) Shoulder belt used with child safety seat _____

(13) Lap belt used with child safety seat _____

(14) Lap and shoulder belt used with child safety seat _____

(15) Belt used with child safety seat—type unknown _____

(18) Other belt used with child safety seat (specify): _____

(99) Unknown if belt used _____

19. Proper Use of Manual (Active) Belts 9

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

20. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

21. Air Bag System Availability/Function 0

- (0) Not equipped/not available
- (1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled _____

(9) Unknown _____

22. Air Bag System Deployment 0

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

23. Are There Indications of Air Bag System Failure? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____

(9) Unknown _____

Note: See Variables 44 through 48 (Page 5)
for Information on Automatic Belts

24. Police Reported Restraint Use 4

- (0) None used
- (1) Police did not indicate restraint use
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt used, type not specified
- (6) Child safety seat
- (7) Other or automatic restraint (specify): _____

(8) Restrained, type unknown _____

(9) Police indicated "unknown" _____

HEAD RESTRAINT AND SEAT EVALUATION

25. Head Restraint Type/Damage by Occupant
at This Occupant Position3

- (0) No head restraints
- (1) Integral—no damage
- (2) Integral—damaged during accident
- (3) Adjustable—no damage
- (4) Adjustable—damaged during accident
- (5) Add-on—no damage
- (6) Add-on—damaged during accident
- (8) Other (specify): _____
- (9) Unknown

26. Seat Type (this Occupant Position)

01

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

27. Seat Performance (this Occupant Position)

1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

28. Child Safety Seat Make/Model

(000) No child safety seat
Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing
(950) Built-in child safety seat
(997) Other make/model (specify):

(998) Unknown make/model
(999) Unknown if child safety seat used

29. Type of Child Safety Seat

(0) No child safety seat
(1) Infant seat
(2) Toddler seat
(3) Convertible seat
(4) Booster seat
(7) Other type child safety seat (specify):

(8) Unknown child safety seat type
(9) Unknown if child safety seat used

30. Child Safety Seat Orientation

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing
(02) Forward facing
(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing
(12) Forward facing
(18) Other orientation (specify):

(19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight

(21) Rear facing
(22) Forward facing
(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

31. Child Safety Seat Harness Usage 32. Child Safety Seat Shield Usage 33. Child Safety Seat Tether Usage

Note: Options below applicable to
Variables OA31-OA33.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
added, not used
(02) After market harness/shield/tether used
(03) Child safety seat used, but no after market
harness/shield/tether added
(09) Unknown if harness/shield/tether
added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
(12) Harness/shield/tether used
(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
(22) Harness/shield/tether used
(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES34. Injury Severity (Police Rating) 0

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

35. Treatment - Mortality 0

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify):

- (9) Unknown

36. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

37. Hospital Stay 00

- (00) Not Hospitalized

_____ Code the number of days (up through 60)
that the occupant stayed in hospital.

- (61) 61 days or more
- (99) Unknown

38. Working Days Lost 99

- _____ Code the number of days
(up through 60) that the occupant
lost from work due to the accident
- (00) No working days lost
 - (61) 61 days or more
 - (62) Fatally injured
 - (97) Not working prior to accident
 - (99) Unknown

STOP - GO TO VARIABLE 44 ON PAGE 7**VARIABLES 39 THROUGH 43 ARE
COMPLETED BY THE ZONE CENTER**39. Time to Death 00

- _____ Code number of hours from time of
accident to time of death up through 24
hours. If time of death is greater than 24
hours, code number of days. (Note: 1 day =
31, 2 days = 32, ... n days = 30 + n up
through 30 days = 60)
- (00) Not fatal
 - (96) Fatal - ruled disease
 - (99) Unknown

40. 1st Medically Reported Cause of Death 0041. 2nd Medically Reported Cause of Death 0042. 3rd Medically Reported Cause of Death 00

- _____ Code the Occupant Injury from line
number(s) for the medically reported
injury(s) which reportedly contributed to
this occupant's death
- (00) Not fatal or no additional causes
 - (96) Mode of death given but specific
injuries are not linked to cause
of death. (specify):

- (97) Other result (includes fatal ruled
disease) (specify):

- (99) Unknown

43. Number of Recorded Injuries for
This Occupant 00

- _____ Code the actual number of
injuries recorded for this occupant.
- (00) No recorded injuries
 - (97) Injured, details unknown
 - (99) Unknown if injured

AUTOMATIC BELT SYSTEM44. Automatic (Passive) Belt System Availability/ Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

45. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

46. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

47. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of automatic belt system (specify): _____
- (9) Unknown

48. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

49. Seat Orientation (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

Check the Primary Source Used In Determining Belt Use.

- [] Not equipped/not available/destroyed or rendered inoperative
- [✓] Vehicle inspection
- [] Official injury data
- [] Driver/occupant interview
- [] Other (specify): _____
- [] Unknown if belt used

ARE ALL APPLICABLE MEDICAL RECORDS INCLUDED WITH INITIAL SUBMISSION?

NO []

YES [✓]

UPDATE CANDIDATE?

NO [✓]

YES []

**STOP - VARIABLES 50 THROUGH 53 ARE
COMPLETED BY THE ZONE CENTER****TRAUMA DATA**

50. Glasgow Coma Scale (GCS) Score 00
(at Medical Facility)
(00) Not injured
(01) Injured - not treated at medical facility
(02) No GCS Score at medical facility
(03-15) Code the actual value of the
initial GCS Score recorded at medical
facility.
(97) Injured, details unknown
(99) Unknown if injured

51. Was the Occupant Given Blood? 1
(1) No - blood not given
(2) Yes - blood given
(specify units): _____
(9) Unknown if blood given

52. Arterial Blood Gases (ABG) - HCO_3 00
(00) Not injured
(01) Injured, ABGs not measured or reported
(02-50) Code the actual value of the HCO_3
(96) ABGs reported, HCO_3 unknown
(97) Injured, details unknown
(99) Unknown if injured

BELT USE DETERMINATION

53. Primary Source of Belt Use Determination 1
(0) Not equipped/not available/destroyed
or rendered inoperative
(1) Vehicle inspection
(2) Official injury data
(3) Driver/occupant interview
(8) Other (specify): _____
(9) Unknown if belt used

PSU NUMBER

02

CASE NUMBER

0266

VEHICLE NUMBER

01

OCCUPANT NUMBER

01

OCCUPANT INJURY FORM

THE FOLLOWING DATA IS NOT INCLUDED IN THIS CASE:

☐ ENTIRE FORM

☐ PAGE NUMBER (S) _____



OCCUPANT ASSESSMENT FORM

OCCUPANT'S SEATING	
<div style="display: flex; justify-content: space-between;"><div>1. Primary Sampling Unit Number</div><div><u>02</u></div></div> <div style="display: flex; justify-content: space-between;"><div>2. Case Number - Stratum</div><div><u>0266</u></div></div> <div style="display: flex; justify-content: space-between;"><div>3. Vehicle Number</div><div><u>01</u></div></div> <div style="display: flex; justify-content: space-between;"><div>4. Occupant Number</div><div><u>02</u></div></div> <div style="background-color: black; color: white; text-align: center; padding: 2px; font-weight: bold;">OCCUPANT'S CHARACTERISTICS</div> <div style="display: flex; justify-content: space-between;"><div>5. Occupant's Age Code actual age at time of accident. (00) Less than one year old (specify by month): (97) 97 years and older (99) Unknown</div><div style="text-align: right;"><u>28</u></div></div> <div style="display: flex; justify-content: space-between;"><div>6. Occupant's Sex (1) Male (2) Female (9) Unknown</div><div style="text-align: right;"><u>2</u></div></div> <div style="display: flex; justify-content: space-between;"><div>7. Occupant's Height Code actual height to the nearest centimeter. (999) Unknown _____ inches X 2.54 = _____ centimeters</div><div style="text-align: right;"><u>999</u></div></div> <div style="display: flex; justify-content: space-between;"><div>8. Occupant's Weight Code actual weight to the nearest kilogram. (999) Unknown _____ pounds X .4536 = _____ kilograms</div><div style="text-align: right;"><u>999</u></div></div> <div style="display: flex; justify-content: space-between;"><div>9. Occupant's Role (1) Driver (2) Passenger (9) Unknown</div><div style="text-align: right;"><u>2</u></div></div>	<div style="display: flex; justify-content: space-between;"><div>10. Occupant's Seat Position</div><div><u>13</u></div></div> <div>Front Seat</div> <div>(11) Left side</div> <div>(12) Middle</div> <div>(13) Right side</div> <div>(14) Other (specify): _____</div> <div>(15) On or in the lap of another occupant</div> <div style="margin-top: 10px;">Second Seat</div> <div>(21) Left side</div> <div>(22) Middle</div> <div>(23) Right side</div> <div>(24) Other (specify): _____</div> <div>(25) On or in the lap of another occupant</div> <div style="margin-top: 10px;">Third Seat</div> <div>(31) Left side</div> <div>(32) Middle</div> <div>(33) Right side</div> <div>(34) Other (specify): _____</div> <div>(35) On or in the lap of another occupant</div> <div style="margin-top: 10px;">Fourth Seat</div> <div>(41) Left side</div> <div>(42) Middle</div> <div>(43) Right side</div> <div>(44) Other (specify): _____</div> <div>(45) On or in the lap of another occupant</div> <div style="margin-top: 10px;">(97) In or on unenclosed area</div> <div style="margin-top: 5px;">(98) Other seat (specify): _____</div> <div style="margin-top: 5px;">(99) Unknown</div> <div style="display: flex; justify-content: space-between; margin-top: 20px;"><div>11. Occupant's Posture</div><div><u>9</u></div></div> <div>(0) Normal posture</div> <div style="margin-top: 10px;">Abnormal posture</div> <div>(1) Kneeling or standing on seat</div> <div>(2) Lying on or across seat</div> <div>(3) Kneeling, standing or sitting in front of seat</div> <div>(4) Sitting sideways or turned to talk with another occupant or to look out a rear window</div> <div>(5) Sitting on a console</div> <div>(6) Lying back in a reclined seat position</div> <div>(7) Bracing with feet or hands on a surface in front of seat</div> <div>(8) Other abnormal posture (specify): _____</div> <div style="margin-top: 10px;">(9) Unknown</div>

EJECTION/ENTRAPMENT12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

(NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)

- (0) Not entrapped
- (1) Entrapped
- (9) Unknown

RESTRAINT SYSTEM EVALUATION

17. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown _____

18. Manual (Active) Belt System Use 04

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

19. Proper Use of Manual (Active) Belts 9

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

20. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

21. Air Bag System Availability/Function 0

- (0) Not equipped/not available
- (1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled

(9) Unknown

22. Air Bag System Deployment 0

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

23. Are There Indications of Air Bag System Failure? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____

(9) Unknown _____

Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts

24. Police Reported Restraint Use 4

- (0) None used
- (1) Police did not indicate restraint use
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt used, type not specified
- (6) Child safety seat
- (7) Other or automatic restraint (specify): _____

(8) Restrained, type unknown

(9) Police indicated "unknown"

HEAD RESTRAINT AND SEAT EVALUATION

25. Head Restraint Type/Damage by Occupant
at This Occupant Position3

- (0) No head restraints
- (1) Integral—no damage
- (2) Integral—damaged during accident
- (3) Adjustable—no damage
- (4) Adjustable—damaged during accident
- (5) Add-on—no damage
- (6) Add-on—damaged during accident
- (8) Other (specify): _____
- (9) Unknown

26. Seat Type (this Occupant Position)

01

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

27. Seat Performance (this Occupant Position)

1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

28. Child Safety Seat Make/Model ○ ○ ○

(000) No child safety seat
Applicable codes are found in your NASS CDS
Data Collection, Coding and Editing
(950) Built-in child safety seat
(997) Other make/model (specify):

(998) Unknown make/model
(999) Unknown if child safety seat used

29. Type of Child Safety Seat ○

(0) No child safety seat
(1) Infant seat
(2) Toddler seat
(3) Convertible seat
(4) Booster seat
(7) Other type child safety seat (specify):

(8) Unknown child safety seat type
(9) Unknown if child safety seat used

30. Child Safety Seat Orientation ○ ○

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing
(02) Forward facing
(08) Other orientation (specify):

(09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing
(12) Forward facing
(18) Other orientation (specify):

(19) Unknown orientation

*Unknown Design or Orientation For This
Age/Weight, or Unknown Age/Weight*

(21) Rear facing
(22) Forward facing
(28) Other orientation (specify):

(29) Unknown orientation

(99) Unknown if child safety seat used

31. Child Safety Seat Harness Usage ○ ○ 32. Child Safety Seat Shield Usage ○ ○ 33. Child Safety Seat Tether Usage ○ ○

Note: Options below applicable to
Variables OA31-OA33.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
added, not used
(02) After market harness/shield/tether used
(03) Child safety seat used, but no after market
harness/shield/tether added
(09) Unknown if harness/shield/tether
added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
(12) Harness/shield/tether used
(19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
(22) Harness/shield/tether used
(29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES34. Injury Severity (Police Rating) 0

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

35. Treatment - Mortality 0

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify):

- (9) Unknown

36. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

37. Hospital Stay 00

- (00) Not Hospitalized

_____ Code the number of days (up through 60) that the occupant stayed in hospital.

- (61) 61 days or more
- (99) Unknown

38. Working Days Lost 99

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
 - (61) 61 days or more
 - (62) Fatally injured
 - (97) Not working prior to accident
 - (99) Unknown

STOP - GO TO VARIABLE 44 ON PAGE 7**VARIABLES 39 THROUGH 43 ARE COMPLETED BY THE ZONE CENTER**39. Time to Death 00

- _____ Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
- (00) Not fatal
 - (96) Fatal - ruled disease
 - (99) Unknown

40. 1st Medically Reported Cause of Death 0041. 2nd Medically Reported Cause of Death 0042. 3rd Medically Reported Cause of Death 00

- _____ Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
- (00) Not fatal or no additional causes
 - (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

- (97) Other result (includes fatal ruled disease) (specify):

- (99) Unknown

43. Number of Recorded Injuries for This Occupant 00

- _____ Code the actual number of injuries recorded for this occupant.
- (00) No recorded injuries
 - (97) Injured, details unknown
 - (99) Unknown if injured

AUTOMATIC BELT SYSTEM44. Automatic (Passive) Belt System Availability/ Function ☐

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

45. Automatic (Passive) Belt System Use ☐

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____

- (3) Automatic belt use unknown
- (9) Unknown

46. Automatic (Passive) Belt System Type ☐

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

47. Proper Use of Automatic (Passive) Belt System ☐

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

- (8) Other improper use of automatic belt system (specify): _____
- (9) Unknown

48. Automatic (Passive) Belt Failure Modes During Accident ☐

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____

- (9) Unknown

49. Seat Orientation (this Occupant Position) ☒

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____

- (9) Unknown

Check the Primary Source Used In Determining Belt Use.

- [] Not equipped/not available/destroyed or rendered inoperative
- [✓] Vehicle inspection
- [] Official injury data
- [] Driver/occupant interview
- [] Other (specify): _____

- [] Unknown if belt used

ARE ALL APPLICABLE MEDICAL RECORDS INCLUDED WITH INITIAL SUBMISSION?

NO [] YES [✓]

UPDATE CANDIDATE?

NO [✓] YES []

**STOP - VARIABLES 50 THROUGH 53 ARE
COMPLETED BY THE ZONE CENTER****TRAUMA DATA**

50. Glasgow Coma Scale (GCS) Score 80
(at Medical Facility)
(00) Not injured
(01) Injured - not treated at medical facility
(02) No GCS Score at medical facility
(03-15) Code the actual value of the
initial GCS Score recorded at medical
facility.
(97) Injured, details unknown
(99) Unknown if injured
51. Was the Occupant Given Blood? 1
(1) No - blood not given
(2) Yes - blood given
(specify units): _____
(9) Unknown if blood given
52. Arterial Blood Gases (ABG) - HCO_3 80
(00) Not injured
(01) Injured, ABGs not measured or reported
(02-50) Code the actual value of the HCO_3
(96) ABGs reported, HCO_3 unknown
(97) Injured, details unknown
(99) Unknown if injured

BELT USE DETERMINATION

53. Primary Source of Belt Use Determination 1
(0) Not equipped/not available/destroyed
or rendered inoperative
(1) Vehicle inspection
(2) Official injury data
(3) Driver/occupant interview
(8) Other (specify): _____
(9) Unknown if belt used

PSU NUMBER	<u>02</u>
CASE NUMBER	<u>0266</u>
VEHICLE NUMBER	<u>01</u>
OCCUPANT NUMBER	<u>02</u>

OCCUPANT INJURY FORM

THE FOLLOWING DATA IS NOT INCLUDED IN THIS CASE:

☐ ENTIRE FORM

☐ PAGE NUMBER (S) _____

FORM NAME	NUMBER OF DOLLAR SIGNS	NUMBER OF LEVEL 1 ERRORS	NUMBER OF LEVEL 2 ERRORS	VERSION NUMBER CONSISTENT
Accident	0	0	0	Y
General Vehicle	0	0	0	Y
Vehicle Exterior	0	0	0	Y
Vehicle Interior	0	0	0	Y
Occupant Assessment	0	0	0	Y
Occupant Interior	0	0	0	Y
Total Inter Errors		0	0	
Total Case Errors	0	0	0	

SLIDE INDEX

Primary Sampling Unit Number 02

Case Number—Stratum 026G

[illegible]

[illegible]



PSU 02-026G (1994) #1



PSU 02-026G (1994) #2



PSU 02-026G (1994) #3



PSU 02-026G (1994) #4



PSU 02-026G (1994) #5



PSU 02-026G (1994) #6



PSU 02-026G (1994) #7



PSU 02-026G (1994) #8



PSU 02-026G (1994) #9



PSU 02-026G (1994) #10



PSU 02-026G (1994) #11



PSU02-026G (1994) #12



PSU 02-026G (1994) #13



PSU 02-028G (1994) #14



PSU 02-026G (1994) #15



PSU 02-026G (1994) #16



PSU 02-026G (1994) #17



PSU 02-026G (1994) #18



PSU 02-026G (1994) #19



PSU 02-026G (1994) #20



PSU 02-026G (1994) #21



PSU 02-026G (1994) #22



PSU 02-028G (1994) #23



PSU 02-026G (1994) #24



PSU 02-026G (1994) #25



PSU 02-028G (1994) #28



PSU 02-026G (1994) #27



PSU 02-026G (1994) #28



PSU 02-026G (1994) #29



PSU 02-026G (1994) #30



PSU 02-026G (1994) #31



PSU 02-026G (1994) #32



PSU 02-026G (1994) #33



PSU 02-026G (1994) #34



PSU 02-026G (1994) #35



PSU 02-026G (1994) #38



PSU 02-026G (1994) #37



PSU 02-026G (1994) #38



PSU 02-026G (1994) #39



PSU 02-026G (1994) #40



PSU 02-026G (1994) #41



PSU 02-026G (1994) #42



PSU 02-026G (1994) #43



PSU 02-026G (1994) #44



PSU 02-026G (1994) #45



PSU 02-026G (1994) #46



PSU 02-026G (1994) #47



PSU 02-026G (1994) #48

Best Available



PSU 02-026G (1994) #49



PSU 02-026G (1994) #50



PSU 02-026G (1994) #51



PSU 02-026G (1994) #52